

BOLTING TORQUE DATA

Torque required to Produce Bolt Stress

Torque, is the measurement of the turning or twisting force applied to an object. This desired result is to hold two parts together with a tension or clamping force that is greater than any external force that could possibly separate them. The part then remains under constant stress and is immune to fatigue. The torque required to produce a certain stress in bolting is dependent upon a number of conditions, some of which are:

- Diameter of bolt
- Type and number of threads on bolt.
- Material on bolt.
- Condition of nut bearing surfaces.

2

2 1/4

2 1/2

23/4

3

8

8

8

8

8

1.838

2.088

2.338

2.588

2.838

2.652

3.423


4.292

5.259

6.324

• Lubrication of bolt threads and nut bearing surfaces.

The tables below reflect the results of many tests to determine the relation between torque and bolt stress. Values are based on steel bolting well lubricated with a heavy graphite and oil mixture. It was found that a non-lubricated bolt has an efficiency of about 50% of a well lubricated bolt and also that different lubricants produce results varying between the limits of 50% - 100% of the tabulated stress figures

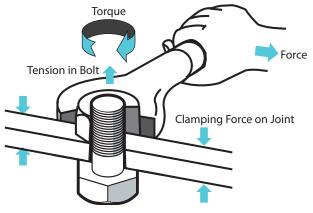

4400

6360

8800

11840

15440

159120

250380

257520

315540

379440

				STRESS					
				30,000 psi		45,000 psi		60,000 psi	
Nominal Diameter of Bolt (inches)	Number of Threads (per inch)	Diameter at Root of Thread (inches)	Area at Root of Thread (sq. inch)	Torque Ft/Lbs	Compression Lbs	Torque Ft/Lbs	Compression Lbs	Torque Ft/Lbs	Compressior Lbs
Data for use with	h Alloy Steel Stu	d Bolts							
.oad in Pounds o	on Stud Bolts wh	ien Torque Loads a	are applied.						
1/4	20	0.185	0.027	4	810	6	1215	8	1620
5/16	18	0.240	0.045	8	1350	12	2025	16	2700
3/8	16	0.294	0.068	12	2040	18	3060	24	4080
7/16	14	0.345	0.093	20	2790	30	4185	40	5580
1/2	13	0.400	0.126	30	3780	45	5670	60	7560
9/16	12	0.454	0.162	45	4860	68	7290	90	9720
5/8	11	0.507	0.202	60	6060	90	9090	120	12120
3/4	10	0.620	0.302	100	9060	150	13590	200	18120
7/8	9	0.731	0.419	160	12570	240	18855	320	25140
1	8	0.838	0.551	245	16530	368	24795	490	33060
1 1/8	8	0.963	0.728	355	21840	533	32760	710	43680
1 1/4	8	1.088	0.929	500	27870	750	41805	100	55740
1 3/8	8	1.213	1.155	680	34650	1020	51975	1360	69300
1 1/2	8	1.338	1.405	800	42150	1200	63225	1600	84300
1 5/8	8	1.463	1.680	1100	50400	1650	75600	2200	100800
13/4	8	1.588	13980	1500	59400	2250	89100	3000	118800
17/8	8	1.713	2.304	2000	69120	3000	103680	4000	138240

79560

102690

128760

157770

189720

3300

4770

6600

8880

11580

119340

154035

193140

236655

284580

2200

3180

4400

5920

7720